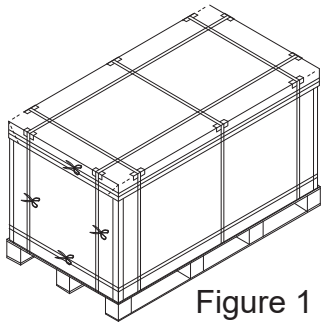# 拆箱说明（1）：
Unpacking Instruction(1)：

Figure 1

1. 用剪刀剪断托盘短边的4根打包带，并取出护楞。
1.Cut off the four packing strips on the short side of the pallet with a scissor. and take out the corrugated paper protector.
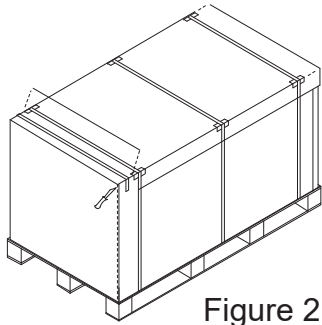
Figure 2

2. 分别从短边两侧翻开箱体侧边塑料PE膜和缠绕膜，沿着箱盖压痕线往上撕开箱盖侧边，并沿长边方向撕开100-140mm，露出玻璃纤维胶带，撕除胶带，再用美工刀沿着其中一侧箱体上竖直的虚线将箱体侧面纸板划开。
2.Tear the plastic PE film and wrapping film from the short side of cardboard. Open up the roof cover along side creasing line and tear 100-140mm from the long side.Remove the fiberglass tape from the top of the carton when it appears.Along the vertical dotted line on the one side of cardboard, cut the sides of the cardboard with a knife.
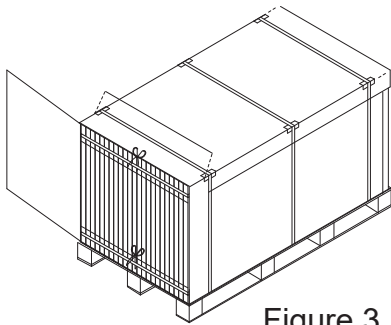
Figure 3

3. 打开侧面纸板，露出组件，用剪刀剪断箱体内部的上下两道横向打包带。
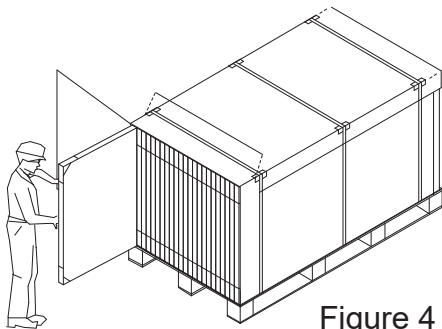3.Open the side board and cut the two horizontal packing belts inside the box with a scissor.

Figure 4

4. 从无纸护楞的一侧抽取1-2块组件后，轻推剩余组件使组件斜靠于箱体上。
4.After taking away 1 or 2 pieces of modules from the side without the paper fender, gently push the remaining modules to lean against the box body.
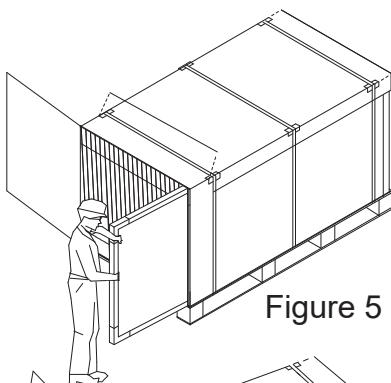
Figure 5

5. 从另一侧取出纸护楞，然后依次抽取剩余组件。
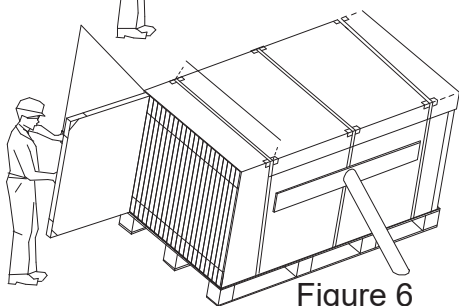5.Remove the paper fender from the other side and then take away the remaining modules.

Figure 6

6. 此拆箱方法需要放置在倾斜角≤15°的地面上操作。如果在非水平地面操作，需要做好防倒措施，或者参考下页的拆箱说明（2）操作。
6.The unpacking method should be used when the tilt angle of ground is less or equal to 15 °. If you are operating on a non-horizontal ground, tilting prevention would be needed, or refer to the unpacking instruction (2) on the next page.
备注：如果拆包后有剩余组件，需使组件平放后重新打包，防止倾倒。
Note: If there are any remaining modules after unpacking, it is necessary to repackage the modules flatwise and prevent dumping.
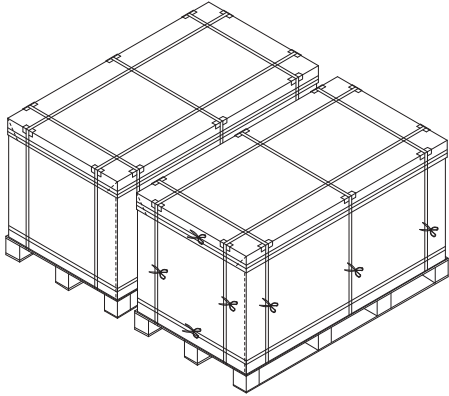
拆箱说明(2)：
Unpacking Instruction(2)：

Figure 1

1. 待拆包的组件长边需要靠近坚实的墙壁、支架或者另外一拖同样规格的未拆组件, 距离约为15-20cm，然后用剪刀剪断外包装全部打包带。

1.The long side of the to be unpacked module pallet need get close to the solid wall, bracket or other unopened module pallet with the same specification and keep a distance of 15 to 20cm. Cut off the outer packing belts with a scissor.
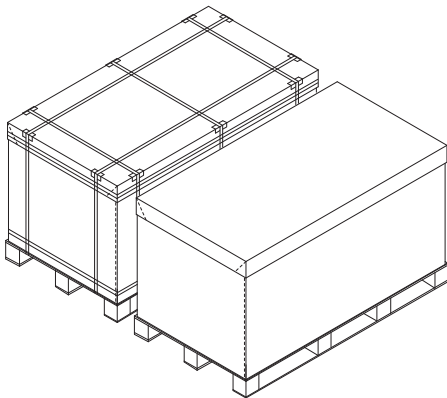
Figure 2

2. 移除箱盖上的塑膜套和围板四周的缠绕膜。

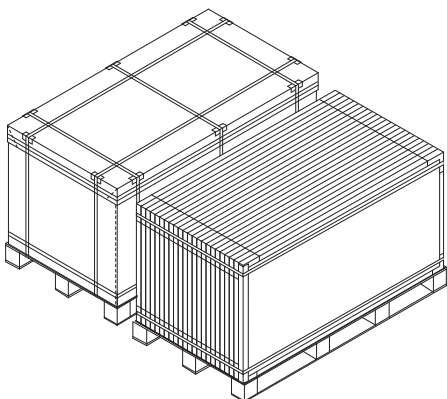2.Remove the plastic film on the cover and wrapping film around the box.

Figure 3

3. 移除玻璃纤维胶带，箱盖和围板。
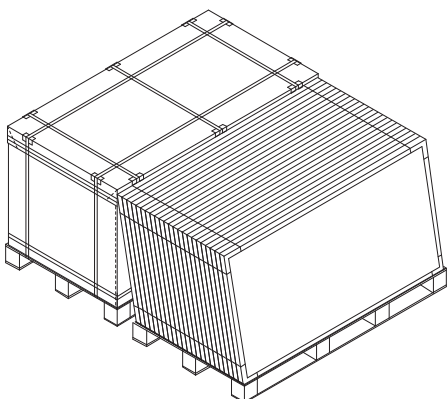
3.Remove the glass fiber tape, cover and surrounding box.

Figure 4

4. 两人扶住组件，防止组件倾倒。另一人拆开打包带，移除打包带和内护楞。扶组件的两人轻推组件，使组件斜靠在支撑物上，然后依次移开所有组件。

4.Two people hold the modules together to prevent the modules from falling. The third man cut the internal packing belts, remove the corner protectors. The two men who hold the modules men who hold the modules gently push the modules and make them lean against a holder, and then remove all the modules in proper order.

备注：如果拆包后有剩余组件，需使组件平放后重新打包，防止倾倒。
Note: If there are any remaining modules after unpacking, it is necessary to repackage the modules flatwise and prevent dumping.

拆箱说明(3)：
Unpacking Instruction(3):

备注：如您购买了拆箱防倒支架，可参照下面流程拆取组件。
Note: if you purchase the unpacking anti overturning tooling, you can refer to the following process to take out the modules.
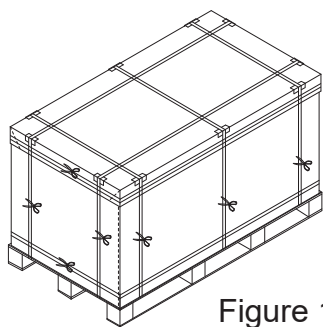
1. 用剪刀剪断外包装全部打包带，并取出护楞。
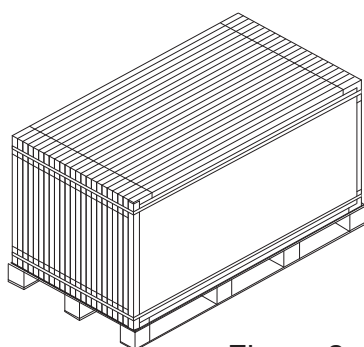1.Cut off the outer packing belts with a scissor. and take out the corrugated paper protector.

Figure 1

2. 移除箱盖上的塑膜套和围板四周的缠绕膜，再移除箱盖，围板和玻璃纤维胶带。
2.Remove the plastic film on the cover and wrapping film around the box.and remove the cover,surrounding box and the glass fiber tape.
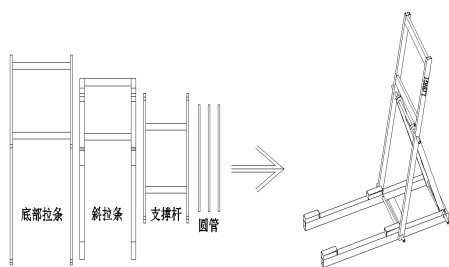
Figure 2

3. 将底部拉条放于地面上，用一根圆管将底部拉条和斜拉条连接起来，然后再用另一根圆管将斜拉条与支撑杆连接起来，整体组装成一个三角形状的支撑架，最后将第三根圆管穿过底部拉条和支撑杆，圆管放于中心位置，避免出现两端长短不一样。
3.Put the bottom brace on the ground, connect the bottom brace and the diagonal brace with a round pipe, then connect the diagonal brace and the support rod with another round pipe, and assemble a triangular support frame as a whole. Finally, put the third round pipe through the bottom brace and the support rod, and place the round pipe in the center to avoid the length difference at both ends.
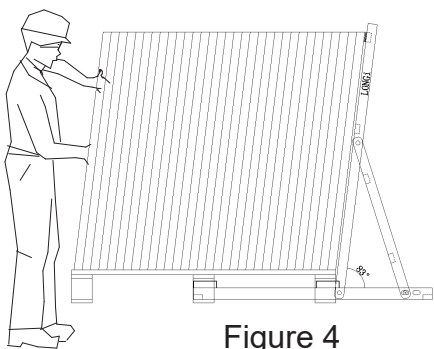
底部拉条　斜拉条　支撑杆　圆管

Figure 3

4. 将组装好的支撑架从托盘底部中间位置插入，紧靠在组件侧面，支撑架底部会牢牢扣住托盘横条，避免出现晃动，然后将固定组件的所有打包带拆散，将组件推倒，全部倚靠在支撑架上。再从另外一侧依次抬取组件。
4. Insert the assembled support frame from the middle position of the bottom of the tray and close to the side of the modules. The bottom of the support frame will firmly fasten the transverse bar of the tray to avoid shaking. Then, dismantle all the packing belts that fix the modules, push all the modules down and rest on the support frame. Then lift the module from the other side in turn.

Figure 4

备注：如果拆包后有剩余组件，需使组件平放后重新打包，防止倾倒。
Note: If there are any remaining modules after unpacking, it is necessary to repackage the modules flatwise and prevent dumping.